


## Information regarding the SOLID 60E-2 Flash Fusing Error 1E/1F

There are 2 scenarios when these errors can appear:

1. *immediately when the printer starts to print.* No flash at all.  
That indicates in most cases a defective flash power supply. But nevertheless all other responsible parts (xenon lamp, cables and connectors, trigger coil) should be checked anyway.
2. *Intermittent, after a random number of pages.* In that case a worn xenon lamp or worn connectors are the most likely reason. But also a worn Trigger coil could be responsible. We recommend to exchange that trigger coil, as a part of preventive maintenance, every 1,8 million pages which means it should be changed together with every second xenon lamp.

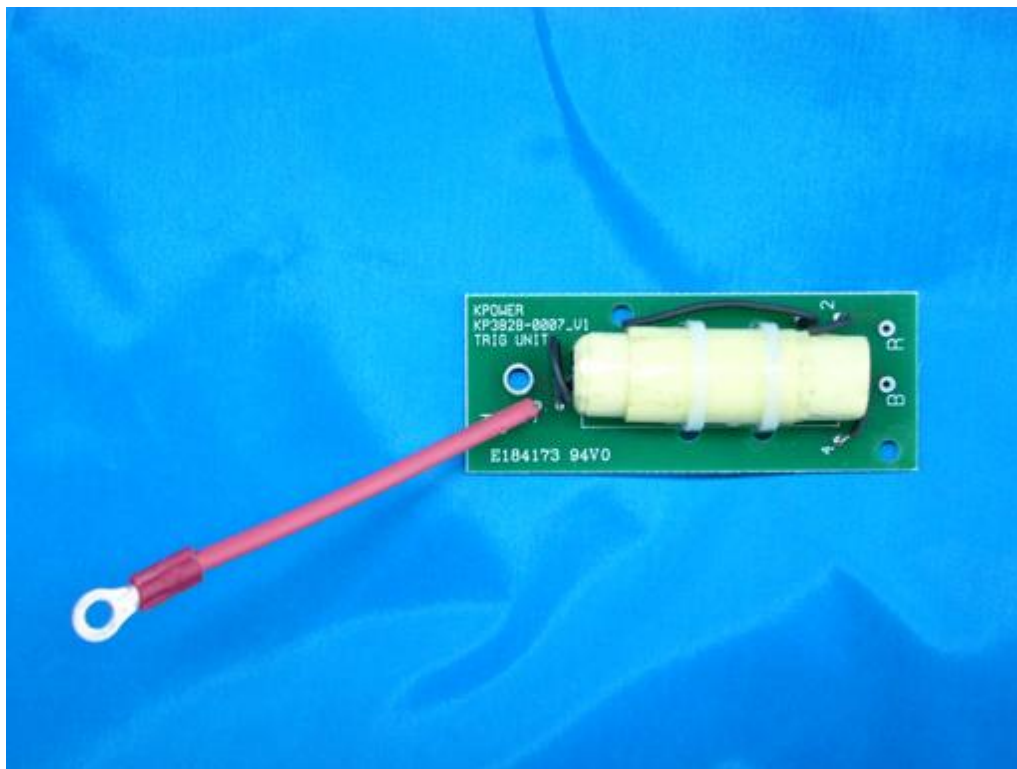

XENON LAMP TRIGGER COIL UNIT <KP03-0312-000-01>